

TOWER C - LEVEL 1 - REINFORCEMENT PLAN 1/8" = 1'-0"

REINFORCING NOTES:

- 1. SEE "GENERAL NOTES" FOR REINFORCING REQUIREMENTS.
- 2. SEE "TYPICAL MILD SLAB DETAILS" FOR ADDITIONAL INFORMATION.
- 3. SLAB REINFORCING SHALL BE PLACED IN THE FOLLOWING SEQUENCE: E-W BOTTOM BARS
 N-S BOTTOM BARS
 N-S TOP BARS
 E-W TOP BARS
- 4. FOR CONTINUOUS BOTTOM BARS, LAP BARS Lsb AS REQUIRED WITH LAPS AT 1/3 THE SLAB SPAN BETWEEN ADJACENT COLUMNS.
- TWO OF THE CONTINUOUS BOTTOM BARS ARE TO BE PLACED EACH WAY THROUGH ALL COLUMNS WITH COLUMN VERTICAL REINFORCEMENT, UNLESS NOTED OTHERWISE.
- 6. BOTTOM BARS CALLED OUT ARE IN ADDITION TO CONTINUOUS BOTTOM MAT.
- 7. RX INDICATES STUD RAIL. STUD RAILS SHALL BE PLACED AT ALL COLUMNS. SEE "TYPICAL STUD RAIL REINFORCEMENT AT COLUMNS" DETAIL AND STUD RAIL SCHEDULE.
- 8. SEE "TYPICAL CONCRETE OPENINGS AND EMBEDMENTS" FOR ADDITIONAL REINFORCEMENT REQUIREMENTS. NOTIFY STRUCTURAL ENGINEER OF ANY OPENINGS NOT SHOWN ON THE STRUCTURAL DRAWINGS FOR WHICH THE TYPICAL DETAILS DO NOT APPLY. ADDITIONAL REINFORCEMENT MAY BE REQUIRED.
- 9. WHERE BAR LENGTH CANNOT BE ACHIEVED DUE TO SLAB EDGE, HOOK BAR.
- 10. WHERE NOTED AS "HOOKED", PROVIDE 90 OR 180 DEGREE HOOK AS SHOWN ON PLAN. NOTED BAR LENGTH IS LENGTH OF STRAIGHT PORTION OF BAR.


11. * INDICATES DIAPHRAGM REINFORCEMENT THAT IS PART OF THE LATERAL FORCE RESISTING SYSTEM AND IS IN ADDITION TO OTHER BARS SHOWN. THIS REINFORCEMENT SHALL BE CENTERED IN SLAB MID-DEPTH, UNO. REINFORCEMENT SHALL MEET CENTER-TO-CENTER SPACING OF 3db BUT NOT LESS THAN 3-INCHES, UNLESS NOTED OTHERWISE. LAP Lsb AS REQUIRED, STAGGER LAPS.


MILD TOP REINFORCEMENT SCHEDULE			
MARK	REINFORCING	REMARKS	
MT1	(13) #6x20'-0" @ 10"	STAGGER 6'-0"	
MT2	(13) #7x20'-0" @ 10"	STAGGER 5'-0"	
MT4	(11) #6x20'-0" @ 12"	STAGGER 4'-0"	
MT6	(11) #6x15'-0" @ 12"	STAGGER 4'-0"	
MT7	(15) #7x30'-0" @ 9"	STAGGER 5'-0"	
MT8	(6) #5x15'-0" @ 12"	STAGGER 3'-0"	
MT9	(6) #7x15'-0" @ 12"	STAGGER 3'-0"	
MT10	(6) #6x20'-0" @ 12"	STAGGER 5'-0"	
MT12	(11) #8x20'-0" @ 12"	STAGGER 5'-0"	
MT13	(16) #8x20'-0" @ 8"	STAGGER 5'-0"	
MT30	#5x20'-0" @ 12"	STAGGER 3'-0"	
MT33	#5x12'-0" @ 12"	STAGGER 2'-0"	
MT40	#6x20'-0" @ 12"	STAGGER 4'-0"	
MT50	(6) #5x24'-2" @ 12"	HOOK AT END	

MARK	REINFORCING	REMARKS
MT51	(11) #5x6'-8" @ 12"	HOOK AT END
MT52	(11) #5x11'-2" @ 12"	HOOK AT END
MT53	(7) #6x11'-0" @ 12"	HOOK AT END
MT55	(16) #6x19'-0" @ 8"	HOOK AT END
MT56	(6) #5x14'-2" @ 12"	HOOK AT END
MT58	(11) #6x14'-0" @ 12"	HOOK AT END
MT81	#5x14'-2" @ 12"	HOOK AT END
MT82	#6x29'-2" @ 12"	HOOK AT END
MT83	#5x19'-3" @ 12"	HOOK AT END
MT84	#5x6'-8" @ 12"	HOOK AT END
MT85	#5x9'-2" @ 12"	HOOK AT END
MT86	#5x11'-2" @ 12"	HOOK AT END
MT92	#6x14'-2" @ 12"	HOOK AT END
MT94	#6x19'-0"@ 8"	HOOK AT END
MT95	#7x18'-10"@ 6"	HOOK AT END
MT96	#7x10'-10" @ 12"	HOOK AT END

MILD TOP REINFORCEMENT SCHEDULE

MILD BOTTOM REINFORCEMENT SCHEDULE				
MARK	REINFORCING	REMARKS		
MB10	#5x20'-0" @ 8"	STAGGER 2'-6"		
MB11	#6x19'-0" @ 6"	HOOK AT END		
MB12	#7x18'-10" @ 6"	STAGGER 3'-0"		
MB14	#5 @ 12"	HOOK BOTH ENDS		

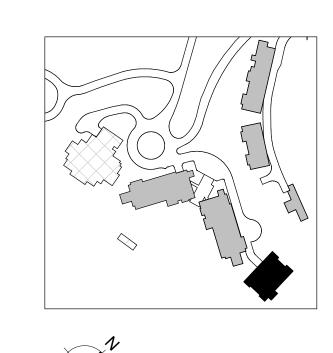

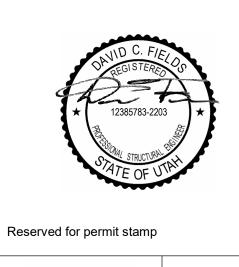

South Jackson St, Suite 600 ttle, Washington 98104 USA 624 5670 olsonkundig.com

Olson Kundig

MAGNUSSON
KLEMENCIC
ASSOCIATES

Structural + Civil Engineers
Seattle Chicago
www.mka.com
206 292 1200

principal architect

project manager

drawn by

checked by

job no. 20052

date 05/17/2024

revisions:

IFC SET 2 OF 3

05/17/2024

2 7/26/2024 ASI-002

11/18/2022 95% CD

no. date

04/08/2024 IFC SET 1 OF 3

TOWER C LEVEL 1 REINFORCING PLAN

S2.C.11.R