

TOWER A - LEVEL 5 - REINFORCEMENT PLAN

1/8" = 1'-0"

REINFORCING NOTES:


- SEE "GENERAL NOTES" FOR REINFORCING REQUIREMENTS.
- 2. SEE "TYPICAL POST-TENSIONED SLAB DETAILS" FOR ADDITIONAL INFORMATION.
- 3. SLAB REINFORCING SHALL BE PLACED IN THE FOLLOWING SEQUENCE: BOT BARS IN DIRECTION OF DISTRIBUTED TENDONS
 BOT BARS IN DIRECTION OF BANDED TENDONS
- TOP BARS IN DIRECTION OF BANDED TENDONS
 TOP BARS IN DIRECTION OF DISTRIBUTED TENDONS
- 4. RX INDICATES STUD RAIL. STUD RAILS SHALL BE PLACED AT ALL COLUMNS. SEE "TYPICAL STUD RAIL REINFORCEMENT AT COLUMNS" DETAIL AND STUD RAIL SCHEDULE.
- 5. SEE "TYPICAL CONCRETE OPENINGS AND EMBEDMENTS" FOR ADDITIONAL REINFORCEMENT REQUIREMENTS. NOTIFY STRUCTURAL ENGINEER OF ANY \
 OPENINGS NOT SHOWN ON THE STRUCTURAL DRAWINGS FOR WHICH THE TYPICAL DETAILS DO NOT APPLY. ADDITIONAL REINFORCEMENT MAY BE REQUIRED.
- 6. WHERE BAR LENGTH CANNOT BE ACHIEVED DUE TO SLAB EDGE, HOOK BAR.
- 7. WHERE NOTES AS "HOOKED", PROVIDE 90 OR 180 DEGREE HOOK AS SHOWN ON PLAN. NOTED BAR LENGTH IS LENGTH OF STRAIGHT PORTION OF BAR.
- 8. PROVIDE INTEGRITY BOTTOM BARS PER STUD RAIL SCHEDULE AT ALL COLUMNS. CENTER REINFORCEMENT ON COLUMNS AND PLACE INTEGRITY BARS EACH WAY WITHIN COLUMN VERTICAL REINFORCEMENT. TRIM AND HOOK AT SLAB EDGE AS REQUIRED.

MARK	REINFORCING	REMARKS
PT1	(6) #5x10'-0"	
PT2	(6) #5x15'-0"	
PT3	(8) #5x15'-0"	
PT4	(12) #5x10'-0"	
PT5	(10) #5x20'-0"	
PT6	(18) #6x12'-0" @ 5"	STAGGER 3'-0"
PT7	(14) #5x10'-0"	
PT8	(16) #6x20'-0"	
PT9	(14) #6x15'-0"	
PT10	(12) #5x20'-0"	
PT11	(12) #5x15'-0"	
PT30	#5x10'-0"@ 15"	
PT31	#5x12'-0"@ 12"	STAGGER 2'-0"
PT33	#5x6'-0" @ 12"	

MARK	REINFORCING	REMARKS
PT50	(3) #5x5'-2"	HOOK AT END
PT51	(6) #5x6'-8"	HOOK AT END
PT52	(10) #5x9'-2"	HOOK AT END
PT53	(8) #5x6'-8" @ 12"	HOOK AT END
PT54	(6) #5x14'-2"	HOOK AT END
PT55	(8) #5x14'-2" @ 12"	HOOK AT END
PT56	(16) #5x11'-2"	HOOK AT END
PT57	(16) #5x14'-2"	HOOK AT END
PT58	(12) #5x6'-8"@12"	HOOK AT END
PT59	(14) #5x11'-2"@12"	HOOK AT END
PT80	#5x11'-2" @ 10"	HOOK AT END
PT81	#5x6'-8" @ 10"	HOOK AT END
PT82	#6x9'-0" @ 4"	HOOK AT END
PT83	#6x9'-0" @ 6"	HOOK AT END
PT84	#6x19'-2" @ 12"	HOOK AT END
PT85	#5x14'-2" @ 12"	HOOK AT END

PT TOP REINFORCEMENT SCHEDULE

MARK	REINFORCING	REMARKS
PB1	#5x10'-0" @ 6"	
PB2	#5x15'-0" @ 12"	
PB7	#5x20'-0" @ 12"	
PB11	#5x15'-0" @ 12"	LAP SPLICE AT DELAY STRIP PER 12/S4.05
PB18	#5x9'-2" @ 12"	HOOK AT END; SEE

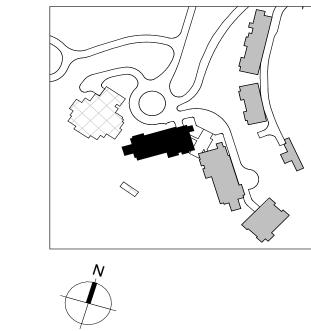



159 South Jackson St. Seattle, Washington 96 +1 206 624 5670 olsonku

MAGNUSSON KLEMENCIC ASSOCIATES

Structural + Civil Engineers

Seattle Chicago www.mka.com 206 292 1200

principal architect
project manager
drawn by
checked by
job no. 20052
date 05/17/2024
revisions:

04/08/2024 IFC SET 1 OF 3 11/18/2022 95% CD

IFC SET 2 OF 3

05/17/2024

TOWER A LEVEL 5 REINFORCING PLAN

S2.A.15.R