

REINFORCING NOTES:

- 1. SEE "GENERAL NOTES" FOR REINFORCING REQUIREMENTS.
- 2. SEE "TYPICAL MILD SLAB DETAILS" FOR ADDITIONAL INFORMATION.
- 3. SLAB REINFORCING SHALL BE PLACED IN THE FOLLOWING SEQUENCE: E-W BOTTOM BARS N-S BOTTOM BARS N-S TOP BARS E-W TOP BARS
- 4. FOR CONTINUOUS BOTTOM BARS, LAP BARS Lsb AS REQUIRED WITH LAPS AT 1/3 THE SLAB SPAN BETWEEN ADJACENT COLUMNS.
- 5. TWO OF THE CONTINUOUS BOTTOM BARS ARE TO BE PLACED EACH WAY THROUGH ALL COLUMNS WITH COLUMN VERTICAL REINFORCEMENT, UNLESS NOTED OTHERWISE.
- 6. BOTTOM BARS CALLED OUT ARE IN ADDITION TO CONTINUOUS BOTTOM MAT.
- 7. RX INDICATES STUD RAIL. STUD RAILS SHALL BE PLACED AT ALL COLUMNS. SEE "TYPICAL STUD RAIL REINFORCEMENT AT COLUMNS" DETAIL AND STUD RAIL SCHEDULE.
- 8. SEE "TYPICAL CONCRETE OPENINGS AND EMBEDMENTS" FOR ADDITIONAL REINFORCEMENT REQUIREMENTS. NOTIFY STRUCTURAL ENGINEER OF ANY OPENINGS NOT SHOWN ON THE STRUCTURAL DRAWINGS FOR WHICH THE TYPICAL DETAILS DO NOT APPLY. ADDITIONAL REINFORCEMENT MAY BE REQUIRED.
- 9. WHERE BAR LENGTH CANNOT BE ACHIEVED DUE TO SLAB EDGE, HOOK BAR.
- 10. WHERE NOTED AS "HOOKED", PROVIDE 90 OR 180 DEGREE HOOK AS SHOWN ON PLAN. NOTED BAR LENGTH IS LENGTH OF STRAIGHT PORTION OF BAR.

TOWER A & B - LEVEL 1 LOBBY FRAMING PLAN 1/8" = 1'-0"


MILE	O TOP REINFORCEMEN	IT SCHEDULE	•	MILD TOP REINFORCEME	NT SCHEDULE	MILE	TOP REINFORCEMEN	IT SCHEDULE
MARK	REINFORCING	REMARKS	MARI	K REINFORCING	REMARKS	MARK	REINFORCING	REMARKS
MT1	(13) #6x20'-0" @ 10"	STAGGER 6'-0"	MT17	7 (11) #4x15'-0" @ 12"	STAGGER 3'-0"	MT50	(6) #5x24'-2" @ 12"	HOOK AT END
MT2	(13) #7x20'-0" @ 10"	STAGGER 5'-0"	MT18	3 (16) #8x20'-0" @ 8"	STAGGER 5'-0"	MT51	(11) #5x6'-8" @ 12"	HOOK AT END
MT3	(11) #7x20'-0" @ 12"	STAGGER 4'-0"	MT30) #5x20'-0" @ 12"	STAGGER 3'-0"	MT52	(11) #5x11'-2" @ 12"	HOOK AT END
MT4	(11) #6x20'-0" @ 12"	STAGGER 4'-0"	MT3 ²	1 #5x20'-0" @ 10"	STAGGER 2'-0"	MT53	(7) #6x11'-0" @ 12"	HOOK AT END
MT5	(13) #5x15'-0" @ 10"	STAGGER 4'-0"	MT32	2 #5x15'-0" @ 12"	STAGGER 2'-0"	MT54	(11) #5x14-2" @ 12"	HOOK AT END
MT6	(11) #6x15'-0" @ 12"	STAGGER 4'-0"	MT33	3 #5x12'-0" @ 12"	STAGGER 2'-0"	MT55	(16) #6x14'-0" @ 8"	HOOK AT END
MT7	(15) #7x15'-0" @ 9"	STAGGER 3'-0"	MT34	#5x20'-0" @ 12"	STAGGER 4'-0"	MT56	(6) #5x14'-2" @ 12"	HOOK AT END
MT8	(6) #5x15'-0" @ 12"	STAGGER 3'-0"	MT3	5 #5x12'-0" @ 12"	STAGGER 1'-0"	MT57	(6) #6x9'-0" @ 12"	HOOK AT END
MT9	(6) #7x15'-0" @ 12"	STAGGER 3'-0"	MT36	6 #5x7'-6" @ 12"	STAGGER 0'-0"	MT58	(11) #6x14'-0" @ 12"	HOOK AT END
MT11	(11) #5x12'-0" @ 12"	STAGGER 2'-0"	MT37	7 #4x12'-0" @ 12"	STAGGER 1'-0"	MT60	(16) #7x10'-10" @ 8"	HOOK AT END
MT12	(16) #8x20'-0" @ 8"	STAGGER 5'-0"	MT38	3 #4x15'-0" @ 12"	STAGGER 1'-0"	MT61	(11) #5x14'-2" @ 12"	HOOK AT END
MT13	(21) #8x20'-0" @ 6"	STAGGER 5'-0"	MT39	9 #5x15'-0" @ 8"	STAGGER 2'-0"	MT62	(11) #4x11'-4" @ 12"	HOOK AT END
MT14	(21) #7x20'-0" @ 6"	STAGGER 5'-0"	MT40) #6x20'-0" @ 12"	STAGGER 4'-0"	MT63	(11) #4x14'-4" @ 12"	HOOK AT END
MT15	(11) #5x15'-0" @ 12"	STAGGER 3'-0"	MT42	2 #6x15'-0" @ 12"	STAGGER 2'-0"	MT64	(11) #4x19'-4" @ 12"	HOOK AT END
MT16	(11) #4x12'-0" @ 12"	STAGGER 2'-0"	MT43	3 #7x15'-0" @ 6"	STAGGER 3'-0"			

." @ 12"	HOOK AT END	MT65	(11) #4x6'-10" @ 12"	HOOK AT END
" @ 12"	HOOK AT END	MT66	(16) #7x18'-10" @ 8"	HOOK AT END
2" @ 12"	HOOK AT END	MT80	#5 @ 12"	HOOK BOTH ENDS
" @ 12"	HOOK AT END	MT81	#5x14'-2" @ 12"	HOOK AT END
2" @ 12"	HOOK AT END	MT82	#6x29'-0" @ 12"	HOOK AT END
0" @ 8"	HOOK AT END	MT83	#5x19'-2" @ 12"	HOOK AT END
." @ 12"	HOOK AT END	MT84	#5x6'-8" @ 12"	HOOK AT END
@ 12"	HOOK AT END	MT85	#5x9'-2" @ 12"	HOOK AT END
0" @ 12"	HOOK AT END	MT86	#5x11'-2" @ 12"	HOOK AT END
10" @ 8"	HOOK AT END	MT87	#6x11'-0" @ 12"	HOOK AT END
2" @ 12"	HOOK AT END	MT88	#4x14'-4" @ 12"	HOOK AT END
4" @ 12"	HOOK AT END	MT89	#4x6'-10" @ 12"	HOOK AT END
4" @ 12"	HOOK AT END	MT90	#4 @ 12"	HOOK BOTH ENDS
4" @ 12"	HOOK AT END	MT91	#4x9'-4" @ 12"	HOOK AT END,
		MT92	#6x14'-0" @ 12"	HOOK AT END
		MT93	#5x19'-2" @ 10"	HOOK AT END
		MT97	#7x10'-10" @ 12"	HOOK AT END
		_		

REMARKS

MILD TOP REINFORCEMENT SCHEDULE

MILD DOTTOM DEINFORGEMENT COLLEGE	
MILD BOTTOM REINFORCEMENT SCHEDULE	
MARK REINFORCING REMARKS	
MB1 #5x20'-0" @ 12" STAGGER 2'-0"	
MB2 #5x12'-0" @ 24" STAGGER 2'-0"	
MB4 (3) #5x12'-0" @ 14" STAGGER 2'-0"	
MB5 #5x20'-0" @ 18" STAGGER 2'-0"	
MB6 #5x20'-0" @ 16" STAGGER 2'-0"	
MB7 (6) #5x15'-0" @ 16" STAGGER 2'-0"	
MB8 (11) #5x20'-0" @ 12" STAGGER 3'-0"	
MB9 (3) #5x15'-0" @ 24" STAGGER 2'-0"	
MB15 (6) #5x30'-0" @ 24" STAGGER 3'-0"	
MB15 (6) #5x30'-0" @ 24" STAGGER 3'-0" MB16 (11) #4x12'-0" @ 12" STAGGER 3'-0"	

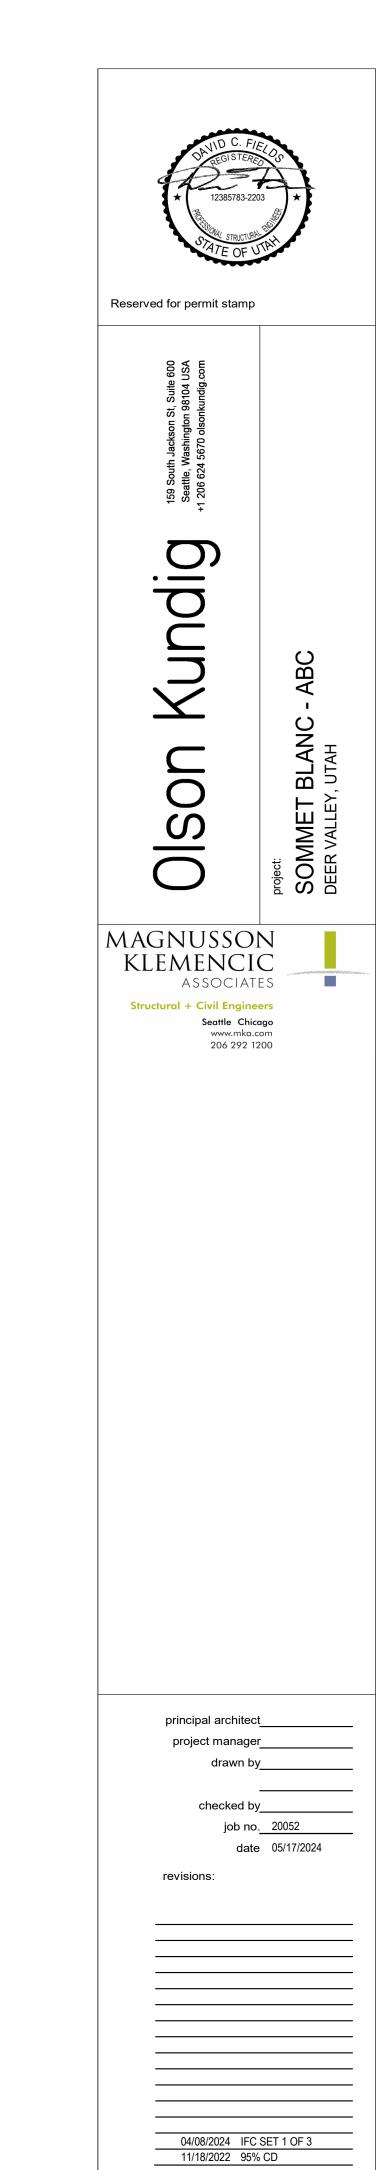

IFC SET 2 OF 3 05/17/2024

AB CONNECTOR LEVEL 1 REINFORCING PLAN

S2.AB.11.R